

Erratum

Paragraph 1 on Page ii in the Executive Summary should be replaced with the following:

Two mitigation measures, a minimum environmental flow and a ramp-down rule, are incorporated into the Hydro Tasmania Special Licence. The minimum winter flow requirement of $20 \text{ m}^3\text{s}^{-1}$ was satisfied for 99.7 % of the time. The minimum summer flow requirement of $10 \text{ m}^3\text{s}^{-1}$ was satisfied for 100 % of the time. Compliance with the environmental flow on an annual basis was 99.8 %. Three non-conformances were recorded for a total of 15 hours.

Section 2.5.4.1 Flow, Paragraphs 4, 5 and 6 on Page 23 should be replaced with the following:

An analysis of hourly flows at site 65 (Figure 2-12 shows that for the winter period (July–November 2008 and June 2009), the minimum flow requirement of $20 \text{ m}^3\text{s}^{-1}$ was satisfied for 99.66 % of the time. The minimum summer (December 2008–May 2009) flow requirement of $10 \text{ m}^3\text{s}^{-1}$ was satisfied for 100 % of the time. Compliance with the environmental flow on an annual basis was 99.83 %. Note that times of shutdown of Gordon Power Station due to maintenance, NEMMCO conformance testing, and/or monitoring have been excluded from the analysis, as per the licence conditions.

Three non-conformances were recorded for a total of 15 hours.

Some additional measures have been implemented to ensure compliance with the minimum environmental flow in future. These are an increase in discharge from the power station by bidding into the market at a higher megawatt target and the use of low flow alarms at the compliance site. With these measures in place it is anticipated that a high level of compliance with the environmental flow requirement will continue.

Section 2.5.4.1 Flow, Table 2-3 on Page 24 should be replaced with the following:

Table 2-3. Environmental low flow non-conformance events at site 65

Date	Maximum flow deficiency (m^3s^{-1})	Duration
07/07/2008	0.4	3 hours
01/06/2009	6.7	9 hours
03/06/2009	1.8	3 hours

Section 2.5.4.1 Flow, Figure 2-12 on Page 25 should be replaced with the following:

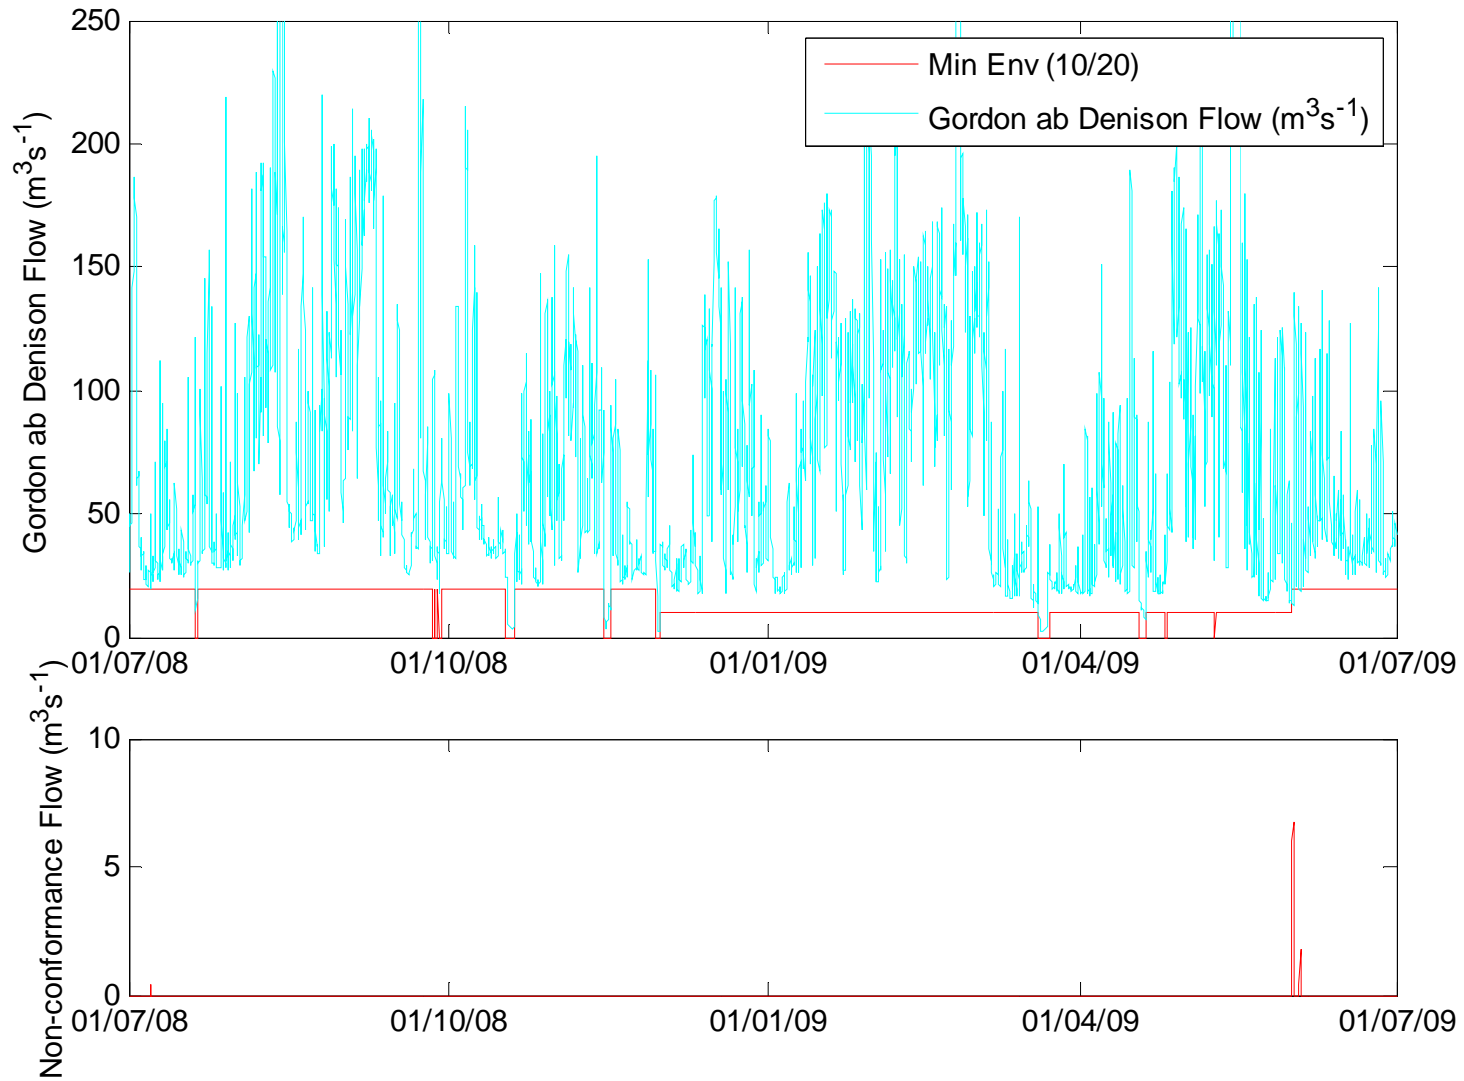


Figure 2-12. Flow recorded (hourly data) at site 65 (Gordon above Denison), from July 2008 to June 2009, and analysis of non-conforming flows